OMB Control No.: 2127-0004

Part 573 Safety Recall Report

23V-110

Manufacturer Name: Lucid USA, Inc. **Submission Date:** FEB 22, 2023 NHTSA Recall No.: 23V-110 Manufacturer Recall No.: SR-23-01-0



Manufacturer Information:

Manufacturer Name: Lucid USA, Inc.

Address: 7373 Gateway Blvd.

Newark CA 94560

Company phone: 1-510-648-3553

Population:

Number of potentially involved: 259 Estimated percentage with defect: 5 %

Vehicle Information:

Vehicle 1: 2022-2023 Lucid Air Vehicle Type: LIGHT VEHICLES

Body Style: 4-DOOR Power Train: NR

Descriptive Information: Sensata Technologies, Inc. (Supplier) manufactures contactors for model year 2022 and 2023 Lucid Air vehicles. Contactors are electrically activated switches that close upon vehicle startup to transfer energy to the drive motors, and open when a vehicle is shut down. Supplier and Lucid determined that in a small population of contactors the spring force may overcome the magnetic holding force. In normal closing operation, the contactor current exhibits a single-dip signature due to motion of the internal components in the magnetic field. A double-dip in the current signature indicates a contactor that may be susceptible to opening unexpectedly due to the spring force issue, though many contactors operate normally even with a double-dip signature. Lucid determined that 18 vehicles manufactured prior to the factory clean point experienced unexpected contactor openings due to the spring force issue. Lucid also observed six vehicles that experienced contactor openings while stationary that could not be confirmed to be due to the spring force issue. No contactor openings due to the spring force issue have occurred in vehicles manufactured after the factory clean point. An over-the-air software update allowed Lucid to analyze customer fleet data and remotely identify at-risk contactors in 232 customer vehicles. Owners of 533 vehicles have not updated their software to enable contactor analysis. Lucid expects that once updated and analyzed, approximately 27 additional vehicles will require contactor replacements. The recalled contactors in the recall population exhibit a double-dip signature during closing more than 5% of the time. Vehicles not in the recall population always exhibit a single-dip closing signature or exhibit a double-dip closing less than 5% of the time. By analyzing known bad contactors, Lucid determined a 5% cut-off is statistically significant in determining potential bad contactors with greater than a 99.999% confidence interval.

Production Dates: OCT 19, 2021 - OCT 14, 2022

☐ Not sequential VIN Range 1: Begin: NR End: NR

Description of Defect:

Description of the Defect: A small population of contactors are susceptible to opening unexpectedly.

FMVSS 1: NR FMVSS 2: NR

Description of the Safety Risk: If a contactor opens unexpectedly while driving, the vehicle's electric motors

will no longer be supplied power. This may lead to a loss of propulsion

without pre-warning and may increase the risk of a crash.

Description of the Cause: Contactors in which the spring force may overcome the magnetic holding force

may unexpectedly open. These defective contactors exhibit double-dip current

signatures during closing.

Identification of Any Warning The driver would not receive a warning prior to an unexpected contactor

that can Occur: opening as a result of this condition. When an unexpected contactor opening

occurs, the driver receives notifications of a system fault and that driving power is reduced. Vehicle displays, power steering, and power brakes will continue to function as they are not powered by the high voltage system.

Involved Components:

Component Name 1: Contactor GXV600-010/-018

Component Description: Contactor, internally economized

Component Part Number: P00-HJ4100-00

Supplier Identification:

Component Manufacturer

Name: Sensata Technologies, Inc.

Address: 529 Pleasant Street

Attleboro Massachusetts 02703

Country: United States

Chronology:

Lucid began investigating this issue in May 2022, following a loss of motive power observed in a vehicle brought to a Lucid Service Center. Through Sept. 2022, Lucid engineers investigated 14 contactor openings. Lucid's Product Safety Working Group was first briefed on Oct. 14. At that time, testing a vehicle for the spring force issue required connecting a measuring device to the vehicle during vehicle startup to observe the contactor closing signature. A double-dip closing signature indicates a risk of a contactor opening, though many

contactors with a double-dip signature have not had unexpected openings. Fewer than 1% of vehicles manufactured prior to the clean point experienced a contactor opening issue. Vehicles experiencing a contactor opening continue to have functional driving displays, power steering, and power brakes, may coast to a stop, and should restart after a vehicle shutdown. Lucid began briefing this issue to the Office of Defects Investigation (ODI) on Nov. 3, 2022, and informed ODI of its plan to develop a software update that would permit telemetric screening of customer vehicles for existence of a single-dip or double-dip current signature. The software update was sent to customer vehicles starting on Dec. 16, and Lucid analyzed contactor closing data in its customer fleet through January 2023. Lucid briefed ODI of its progress in early January and early February 2023. After analyzing the fleet data, Lucid determined that 232 customer vehicles exhibit double-dip current signatures at least 5% of the time, which represents a greater than 99.999% confidence interval for capturing vehicles with potentially affected contactors. As of Feb. 22, owners of 533 vehicles have not updated their software; 27 of these are expected to require a contactor replacement. The Lucid Product Safety Executive Committee determined on February 14 that an unreasonable risk to safety exists and that Lucid would recall these vehicles and replace the contactors.

Description of Remedy:

Description of Remedy Program: Owners of subject vehicles will be notified by first class mail with instructions when to contact Lucid to schedule replacement of contactors at NO COST to the customer. Owners of vehicles who did not download the software update for the double dip test will be notified by first class mail to update their software at home or bring their vehicles to a Service Center for a software update. After Lucid analyzes the contactor data provided by the software update, Lucid will replace contactors showing a double-dip signature at NO COST to the customer. Lucid will reimburse owners for costs an owner reasonably incurred to obtain a remedy for this safety defect during the period starting from initial vehicle delivery through 10 days after Lucid's mailing of the owner notification letter concerning this noncompliance. If an owner has such a claim for pre-notification reimbursement, they may contact Lucid Customer Care at 1-888-99-LUCID or 1-888-995-8243.

How Remedy Component Differs Replacement contactors have been redesigned to have increased magnetic from Recalled Component: holding force and have undergone additional quality screening to ensure they do not exhibit a double dip current signature during closing.

was Corrected in Production:

Identify How/When Recall Condition As of the factory clean point on October 29, 2022, all contactors used in manufactured vehicles include the redesign for increased magnetic holding force or have undergone additional quality screening to ensure they do not exhibit a double dip current signature during closing.

Recall Schedule:

Description of Recall Schedule: Owners of the 232 known affected vehicles will be notified by first class mail with instructions that they may contact Lucid Customer Care or a Lucid Certified Service Center to schedule the recall repair. There will be NO COST for this service.

Owners of the 533 vehicles requiring a software update to assess their contactors will be notified via first class mail with instructions to bring their software up to date or to contact Lucid Customer Care or a Lucid Service Center to schedule assistance in bringing their software up to date. Lucid will evaluate the contactor closing signatures of updated vehicles to determine whether any require contactor replacements and will notify those customers needing replacement to contact Lucid Customer Care or a Lucid Service Center to schedule the recall repair. Lucid will send reminder emails to all customers who have uncompleted recall campaigns every six months.

Planned Dealer Notification Date : FEB 22, 2023 - FEB 22, 2023 Planned Owner Notification Date : APR 21, 2023 - APR 21, 2023

* NR - Not Reported