

| | | | |
|--|-------------------|---|-----------------------|
|  Tesla, Inc. Service Bulletin | | <h2>Replace Front Fascia Harness and Front Fascia Camera</h2> | |
| SB-25-17-012 February 18, 2026 | | | |
| Classification | | Section/Group | Mobile Service |
| Campaign Bulletin | | 17 - Electrical | Cannot Perform |
| Configuration | | All | |
| Model | Model Year | Country/Region | Build Location |
| Model Y | 2025+ | North America | Fremont, Giga Texas |
| <small>The model(s) and model year(s) listed are a general approximation of the affected VIN list. Refer to the VIN/Bulletin Tracker or Customer/Vehicle profile to determine applicability of this bulletin for a particular vehicle.</small> | | | |

Campaign Bulletin: This campaign bulletin addresses a non-safety-related condition and provides recommended technical diagnosis and repair procedures. Apply this procedure to the applicable vehicles.

Condition

On some Model Y vehicles, water may ingress into the front fascia camera via the channels on the front fascia harness. This may corrode the camera connector or submerge the camera lens, which results in camera alerts and possible loss of the front fascia camera feed.

Correction

Inspect the vehicle for symptoms related to the condition. If symptoms are present, replace the front fascia harness and the front fascia camera.

| Correction Description | Correction | Time |
|---|------------|------|
| Inspect Front Fascia Harness and Front Fascia Camera; Replacements Unneeded | S012517012 | 0.84 |
| Inspect and Replace Front Fascia Harness and Front Fascia Camera | S022517012 | 0.90 |

| Part Number | Description | Quantity |
|--|-----------------------------------|----------|
| If Necessary 1933899-00-C | ASY,HARN,FR FASCIA | 1 |
| 1972134-00-D | FASCIA CAMERA ASSEMBLY | 1 |
| These part numbers were current at the time of publication. Use the revisions listed or later, unless otherwise specified in the Parts Catalog . | | |
| Shop Supplies | Electrical tape | |
| | Masking tape | |
| | LED flashlight | |
| 000-0474-001 | THREADLOCKER, LOCTITE 222, PURPLE | |

Procedure

1. On the vehicle touchscreen, touch **Controls** (vehicle icon) > **Software**, then scroll down to display the vehicle firmware version.
 - If the vehicle is operating with firmware version 2025.44.3 or later or FSD V14.2, no further action is necessary.
 - If not, update the software (refer to Service Manual procedure [00020003](#)).
2. Inspect the front fascia camera visibility on the vehicle touchscreen for signs of water ingress such as severe blurriness, intermittent or blank video feed (Figure 1)
 - If signs of water ingress are present, replace both the front fascia camera and the front fascia harness (refer to Service Manual procedures [1722010012](#) and [1710040202](#)), then skip to step 11.
 - If no signs of water ingress are present, proceed to step 3.

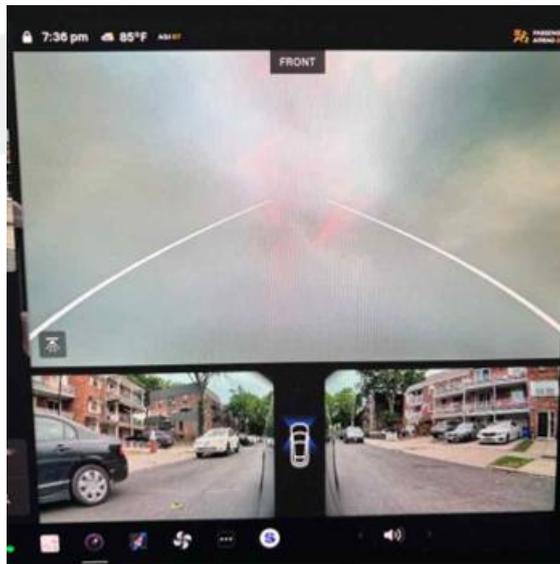


Figure 1

3. Remove the front fascia camera (refer to Service Manual procedure [1722010011](#)).
4. Use an LED flashlight to inspect the front fascia camera lens and connector for any signs of water ingress or corrosion (Figures 2 and 3).
 - If any signs of water ingress or corrosion are present, replace both the front fascia camera and the front fascia harness (refer to Service Manual procedures [1722010012](#) and [1710040202](#)), then skip to step 11.
 - If no signs of water ingress or corrosion are present, proceed to step 5.

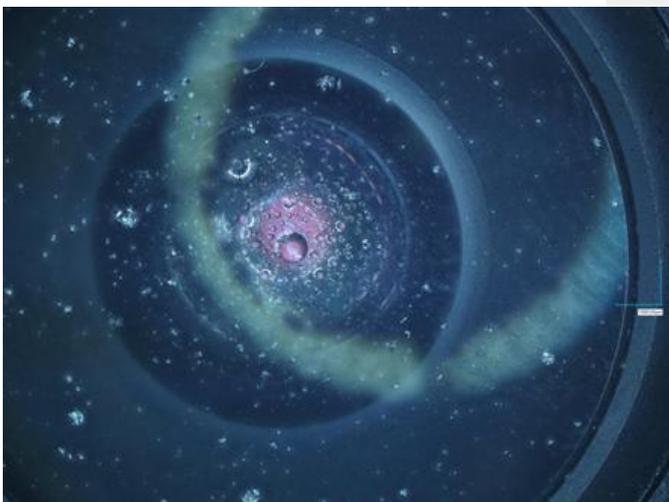


Figure 2: Water inside of camera

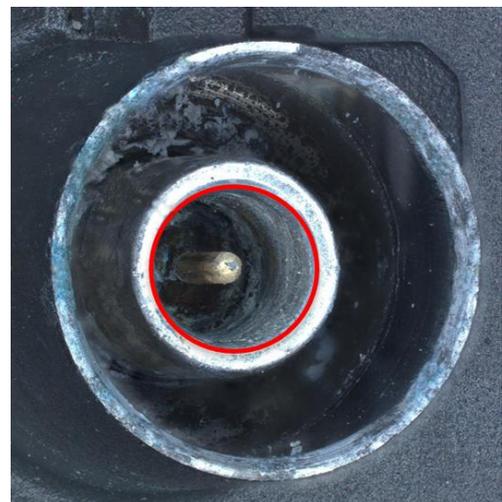


Figure 3: Corrosion on connector and wall

5. Remove the front fascia (refer to Service Manual procedure [1001020501](#)).
6. Remove the camera connector branch of the front fascia harness from the fascia.
 - a. Remove the fir-tree clips (x4) that attach the camera connector branch of the front fascia harness to the fascia (Figure 4).



Figure 4

- b. Release the camera connector branch of the front fascia harness from the hook (Figure 5).

 **NOTE:** Model Y Performance vehicles have an additional hook on the RH duct.

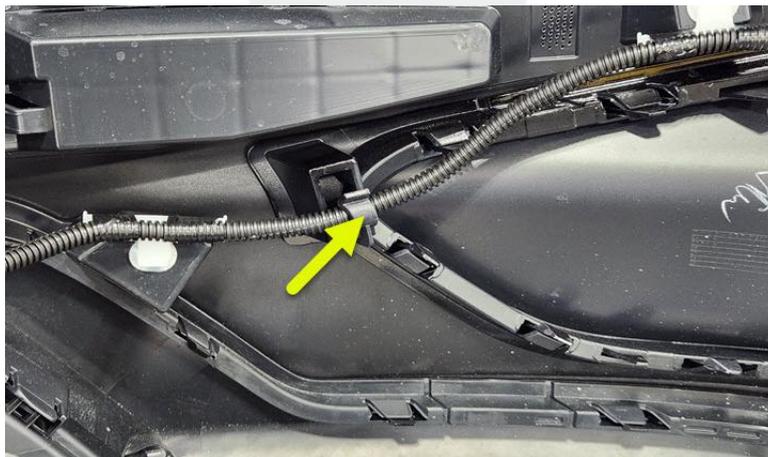


Figure 5

7. Peel the tubing off of the entire branch of the front fascia harness with the green coaxial connector (Figures 6 and 7).



Figure 6



Figure 7

8. Inspect the harness for signs of abrasion or water ingress (Figures 8 – 11).

- If any signs of abrasion or water ingress are present, replace both the front fascia camera and front fascia harness (refer to Service Manual procedures [1722010012](#) and [1710040202](#)), then skip to step 11.
- If no damage or water ingress is present on the harness, reinstall the corrugated tubing onto the harness and wrap the end of the tube near the camera connector with electrical tape.

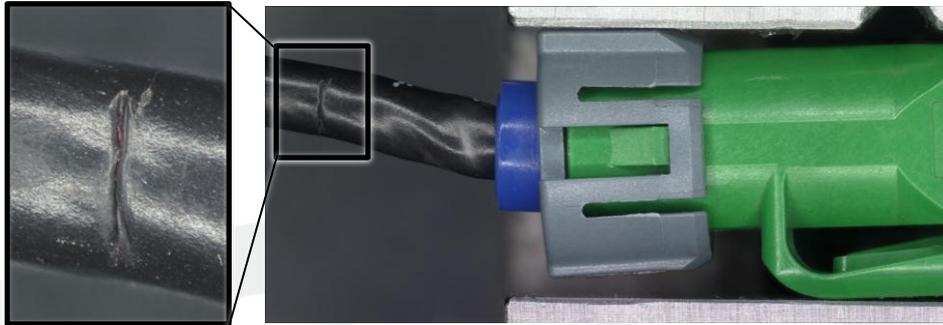


Figure 8

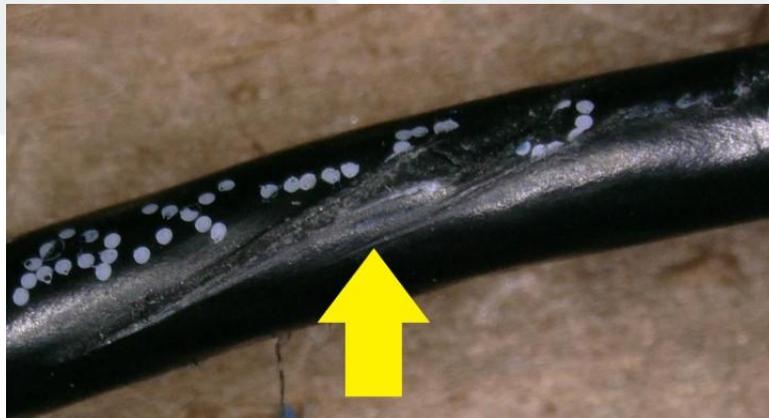


Figure 9



Figure 10



Figure 11

9. Install the front fascia harness. Refer to step 6.

10. Install the front fascia camera (refer to Service Manual procedure [1722010011](#)).

11. Install the front fascia (refer to Service Manual procedure [1001020501](#)).

12. Complete the repair order to automatically update the vehicle configuration which indicates that the repair has been performed.

 **NOTE:** The gateway configuration update is verified as part of an automated remote process.